HO-948 Washington Boulevard near Oak Meade Way Waterloo vicinity

Description:

The house at Washington Boulevard near Oak Meade Way is a two-story, two-bay by two-bay log structure with no visible foundation and a gable roof with asphalt shingles and a northeast-southwest ridge. The walls are constructed primarily with halved logs left in the round on the exterior, with saddle notches at the corners. The gable ends are also of logs, with a shallow pitch to the roof. The logs are severely deteriorated and have a Portland cement chinking, with no evidence of any exterior covering. The house faces southeast toward the road, and this elevation has a doorway in the center of the first story, with the partial remains of a brick wall of unknown function to the east of the doorway. The second story has two window openings. The southwest elevation has two window openings on the first story and one, set west of center, on the second story. The window frames seem to all be of dimensional lumber with wire nails, and several openings have the remains of four-over-four sash. The northwest elevation contains a doorway in the center of the first story and most of the logs of the second story have collapsed. There is a CMU chimney here and debris that suggests there was a wing here on the rear. The northeast elevation has two windows on the first story and had one on the second story, but again, some of the logs around this opening have collapsed. The first story is one room with a straight run of stairs along the southwest wall. There is no flooring and the joists are dimensional lumber that runs northeast-southwest. The walls are covered with plywood and the openings have head-cut trim. The second story was not accessible considering the deteriorated condition of the building.

Significance:

The house at Washington Boulevard near Oak Meade Way has construction that is consistent with the popular rediscovery of log building in the twentieth century. Several other examples of this could be found on Washington Boulevard, including the Log Cabin Restaurant (HO-827), which was recently demolished. This example near Oak Meade Way appears to be home-made, rather than contractor-built, and may be a local response to the need for cheap housing during the Depression. Though it is not threatened by development, since it is sitting in a wooded section of a development and is owned by the local homeowner's association, it is unfortunately in a very deteriorated state and is beyond preservation.

Maryland Historical Trust Maryland Inventory of Historic Properties Form

Inventory No.

HO-948

1. Name of P	roperty	(indicate prefer	rred name)				
historic							
other							
2. Location							
street and number	Washingto	n Boulevard nr. Oak M	eade Way			not for publicat	tion
city, town	Waterloo				X	vicinity	
county	Howard						
3. Owner of F	Property	(give names and m	ailing addresses	of all owners	5)		
name	Pleasant Ch	ase Homeowners Assn,	c/o Residential l	Re			
street and number	3600 Crond	all Lane, Suite 103			telephon	е	
city, town	Owings Mil	ls	state	MD	zip code	21117	
4. Location o	f Legal D	escription					
courthouse, registry	of deeds, etc. I	Howard County Courtho	ouse		tax map and p	arcel: 43, 211	
city, town	Ellicott City				liber 5125	folio 2	26
Contributing R Contributing R Determined El Determined In Recorded by H Historic Struct Other	Resource in Nation Resource in Local Resource in	F Additional Donal Register District al Historic District ational Register/Marylan lational Register/Marylan esearch Report	d Register				
6. Classificat	(C. 4. (C						
district	Ownership public private both	Current Functionagriculturecommerce/tradedefensedomesticeducationfunerarygovernment health care	landscape recreation/o religion social transportati work in pro unknown X vacant/not	on gress	Resource C Contributing 1 0 0 0 1	Noncontribut	ildings es uctures jects tal

7	. Des	cription			Inventory No.	HO-948
	Co	ondition				
		excellent		deteriorated		
		good	_X_	ruins		
		fair		altered		

Prepare both a one paragraph summary and a comprehensive description of the resource and its various elements as it exists today.

The house at Washington Boulevard near Oak Meade Way is a two-story, two-bay by two-bay log structure with no visible foundation and a gable roof with asphalt shingles and a northeast-southwest ridge. The walls are constructed primarily with halved logs left in the round on the exterior, with saddle notches at the corners. The gable ends are also of logs, with a shallow pitch to the roof. The logs are severely deteriorated and have a Portland cement chinking, with no evidence of any exterior covering. The house faces southeast toward the road, and this elevation has a doorway in the center of the first story, with the partial remains of a brick wall of unknown function to the east of the doorway. The second story has two window openings. The southwest elevation has two window openings on the first story and one, set west of center, on the second story. The window frames seem to all be of dimensional lumber with wire nails, and several openings have the remains of four-over-four sash. The northwest elevation contains a doorway in the center of the first story and most of the logs of the second story have collapsed. There is a CMU chimney here and debris that suggests there was a wing here on the rear. The northeast elevation has two windows on the first story and had one on the second story, but again, some of the logs around this opening have collapsed.

The first story is one room with a straight run of stairs along the southwest wall. There is no flooring and the joists are dimensional lumber that runs northeast-southwest. The walls are covered with plywood and the openings have head-cut trim. The second story was not accessible considering the deteriorated condition of the building.

Inventory No. HO-948					
ment					

Prepare a one-paragraph summary statement of significance addressing applicable criteria, followed by a narrative discussion of the history of the resource and its context. (For compliance reports, complete evaluation on a DOE Form - see manual.)

The house at Washington Boulevard near Oak Meade Way has construction that is consistent with the popular rediscovery of log building in the twentieth century. Several other examples of this could be found on Washington Boulevard, including the Log Cabin Restaurant (HO-827), which was recently demolished. This example near Oak Meade Way appears to be home-made, rather than contractor-built, and may be a local response to the need for cheap housing during the Depression. Though it is not threatened by development, since it is sitting in a wooded section of a development and is owned by the local homeowner's association, it is unfortunately in a very deteriorated state and is beyond preservation.

9. Major Bibliographical References

Inventory No. HO-948

See continuation sheet. foot notes

10. Geographical Da	ata	D	al	ca	١i	ł	p	ra	a	0	e	G	0.	1
---------------------	-----	---	----	----	----	---	---	----	---	---	---	---	----	---

Acreage of surveyed property 9.24 A

Acreage of historical setting

unknown

Quadrangle name

Savage

Quadrangle scale

1:24000

Verbal boundary description and justification

The boundaries consist of all of the property lines on the south and east, and lines parallel to these but 100 feet north and west of them. which encompasses all of the historic structures.

11. Form Prepared By

name/title	Ken Short		
organization	Howard County Dept. of Planning & Zoning	date	9/17/2008
street and number	3430 Courthouse Drive	telephone	410-313-4335
city or town	Ellicott City	state MD	zip code 21043

The Maryland Inventory of Historic Properties was officially created by an Act of the Maryland Legislature to be found in the Annotated Code of Maryland, Article 41, Section 181 KA, 1974 supplement.

The survey and inventory are being prepared for information and record purposes only and do not constitute any infringement of individual property rights.

return to:

Maryland Historical Trust


DHCD/DHCP

100 Community Place

Crownsville MD 21032

410-514-7600


HO-948 Log structure Washington Boulevard (US 1) near Oak Meade Way, Jessup Savage Quadrangle 1957 (Photorevised 1966 and 1974)

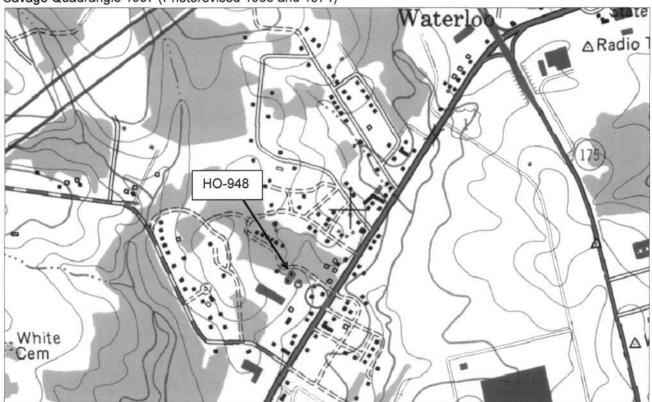

Howard County Aerial Photography Viewer, Summer 2009 Bing Maps Birds's eye image, c. 2010




HO-948 Log structure Washington Boulevard (US 1) near Oak Meade Way, Jessup Howard County Tax Map 43, p. 211, Lot 142

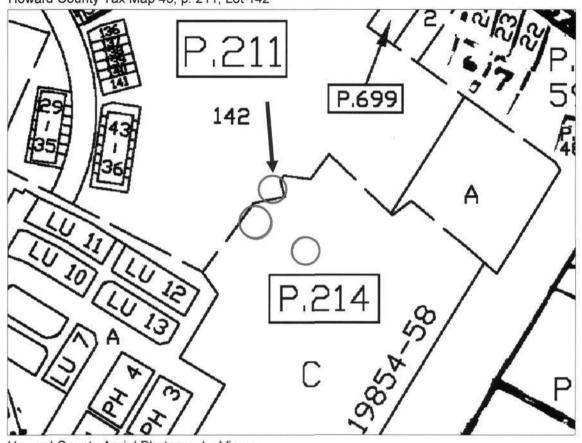

Howard County Aerial Photography Viewer



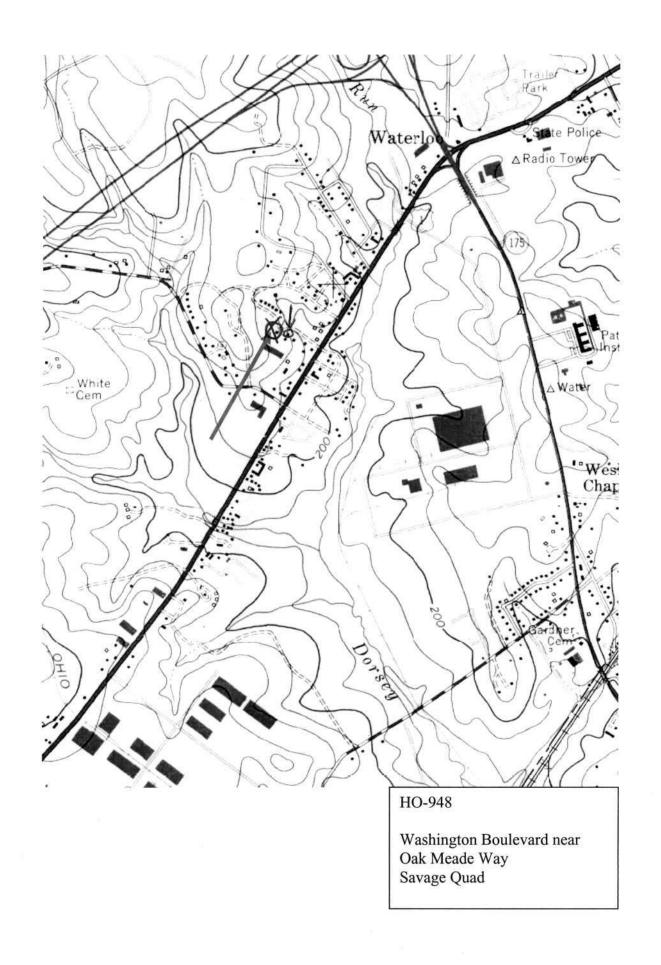

Ken Short, photographer

Photo Log

Nikon D-70 camera HP Premium Plus paper HP Gray Photo print cartridge

HO-0948_20070914_01 Southeast elevation

HO-0948_20070914_02 Southwest elevation

HO-0948_20070914_03 Northwest elevation

HO-0948_20070914_04 Interior, view northeast



40-948 Washington Blod nr. Oak Meade Way Howard G. MD Ben Short, photographer 9-14-07 Southeast elevation





Ho-948 Washington Blod nr. Oak Meade Way 40-948 Howard Co MD Ben Short, photographer 9-14-07 Southwest elevation





HO-948 Washington Blod na Ook Meade way Howard & MD Ken Shout, photographer 9-14-07 Morthwest elevation





1111 Ho-948 Washington Blod no Oak Meade Howard COMD Way Ken Short, photographer 9-14-07 Interior, view northeast

