
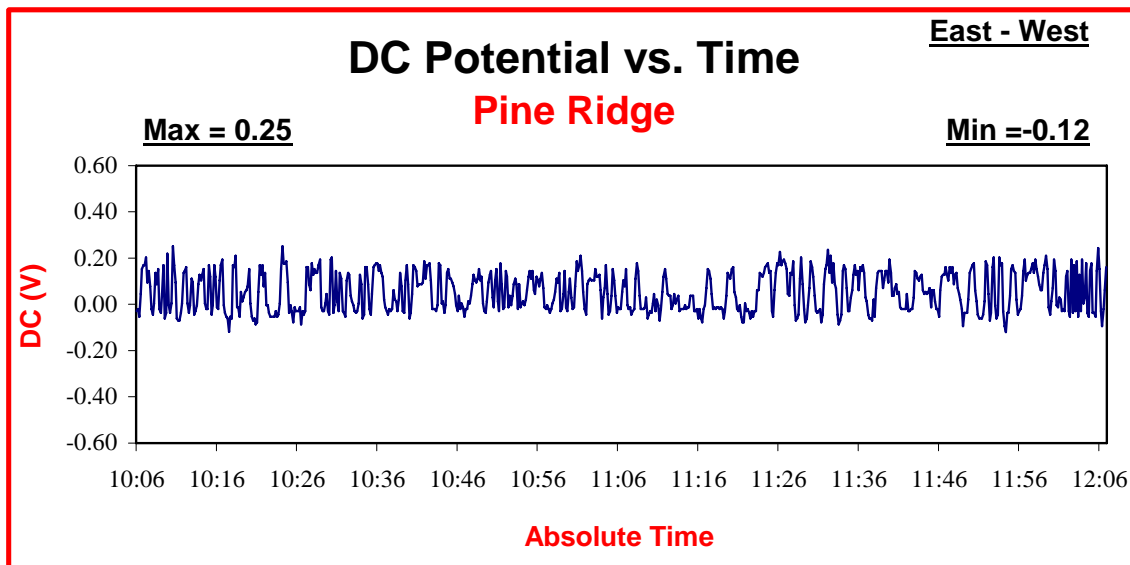


Pine Ridge

One (1) stray current measurement was taken in the Pine Ridge community, close to where the service pipe branches off, shown in Figure 36. The results are shown in Figure 37.



Figure 36 - Stray Current Testing in Pine Ridge Community

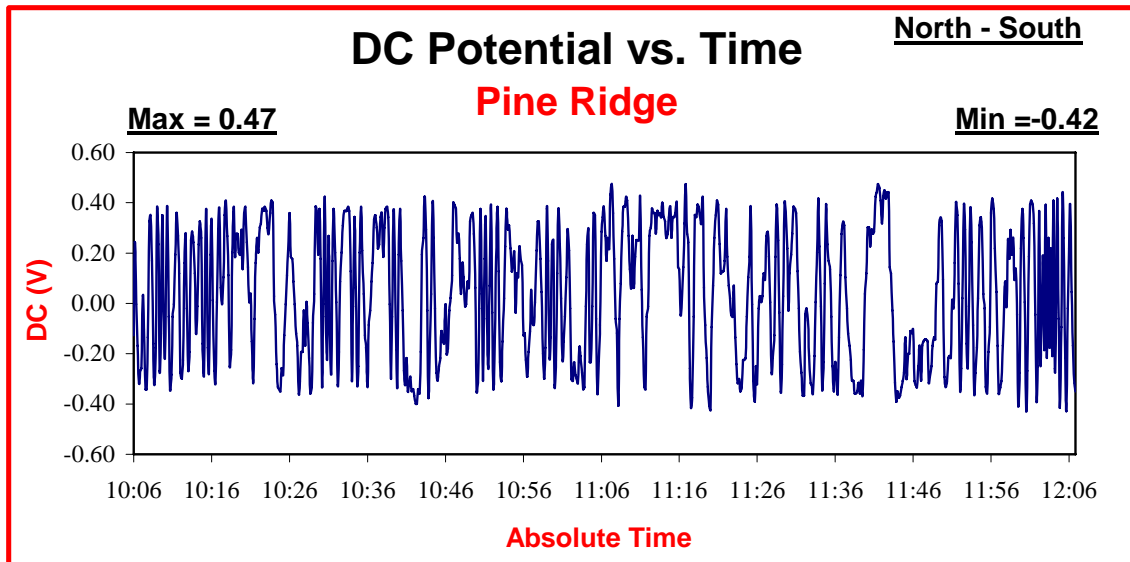

Location:	Pine Ridge Apartments	
GPS Location:	N 39° 11.854', W 76° 44.734'	
	North-South	East-West
Date:	10/25/2006	10/25/2006
Time:	10:06:02	10:06:02
Maximum (V):	0.47	0.25
Minimum (V):	-0.42	-0.12
DC Potential Shifts (V):	0.89	0.37

Figure 37 - Stray Current Result for Pine Ridge

Marble Hill

Stray current measurements were taken at five (5) locations in the Marble Hill community